
NIMO

ComBi-Line NG Software versions

Date: Oktober 2024

1.7 HARDWARE AND SOFTWARE INFO / Check the INTERFACE SOFTWARE: x.xx

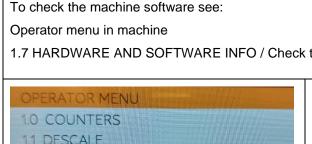

1.1 DESCALE 1.2 SYSTEM SETTINGS 1.3 BREW SETTINGS

1.4 HOT WATER SETTINGS

1.5 LOADING FACTORY DEFAULT

1.6 SERVICE MENU

1.7 HARDWARE AND SOFTWARE INFO



HARDWARE AND SOFTWARE INFO DEALERINFO" NTERFACE HARDWARE: 1.0 NTERFACE SOFTWARE: 1.06 XF MAIN CONTROLLER HARDWARE: 1.1 MAIN CONTROLLER SOFTWARE: 1.01 LANGUAGE DATA: 1.06 GRAPHICAL DATA: 1.01 LANGUAGE DATA_1 CN: 1.03

Combi-Line NG software V1.06.01 (release date 14 Oktober 2024)

Model CB40 only:

- the "maximum coffee heating time" has been changed to 30 min, because of Error 206.


Combi-Line NG software V1.06 (release date April 2023)

New functions added:

BOILER START UP AUTOMATIC (Default = OFF)

[Service menu / 2.4 Hot water settings / 2.4.5 Boiler start-up automatic]

- ON = Hot water boiler <u>automatically active</u> (ON) when machine is switched ON with the main switch.
- OFF = Hot water boiler <u>must be activated by hand</u> when machine is switched ON with the main switch.

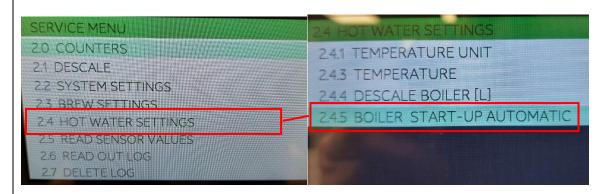


New functions added (continuation):

HEATING PRIORITY (Default = ON)

[Service menu / 2.2 System settings / 2.2.14 Enable priority]

- ON = Flow heater has priority above Hot water boiler heater (low Amps)
- OFF = Flow heater & Hot water boiler heat together (Attention: High Amps, check cable and plug spec's)

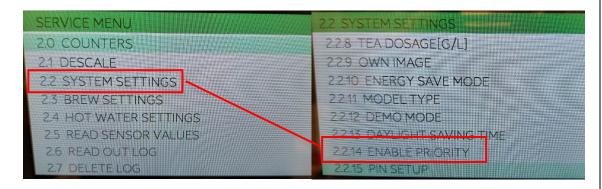


– PIN CODE (Default = OFF)

Control panel with active PIN will be protected after 30 seconds with PIN code to block the control panel.

[Service menu / System settings / 2.2.15 PIN setup]

- OFF = no PIN
- ON = PIN [1 1 1 1 1] PIN can be changed
- PIN lost?; Change PIN in Operator menu.

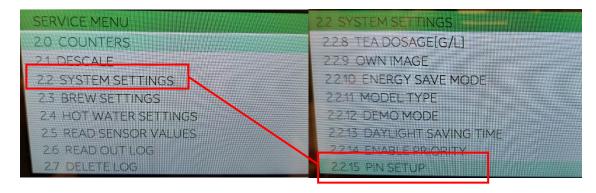

Fixes issues:

- Brewing quantity for jugs and cups was not saved when switching off/on.
- With a disconnect and/or defective flow meter, the machine's brewing process did not cancel.
- Descaling program stuck [program paused, press OK], bug solved.
- When the descaling counter is set to "0", the descaling symbol appears immediately.
- Only for Model CB 40: Not all heating elements are controlled during descaling, which means less splashing during descaling

Combi-Line NG software V1.05.01 (release date 23-12-2019)

- Some texts in Finnish and Swedish corrected

Combi-Line NG software V1.05 (release date 21-01-2019)

- Model CB40 added
- Solved for jumping back to default

Combi-Line NG software V1.04 (release date 27-03-2018)

- Chinese language added (only in combination with the right hardware)

Combi-Line NG software V1.03 (release date 29-11-2017)

- Changing the temperature in the first installation is now working well

- Model CB40 added (beta version)
- In demo mode, descaling can no longer be started
- Screen 'check empty' added in timer menu
- More info if error 215 occurs

Combi-Line NG software V1.02 (release date 20-07-2017)

- Demo mode had too much protection against unwanted activation
- 97.0+ mode lingered in eco mode
- model without container is waiting for container at timer mode
- model only left or right now waits for correct swivel with timer
- now saving counters to zero immediately
- if there is a container on both sides of a 1-sided model, the detection not OK
- completion of the restart time was 5 minutes, now after 1 minute the auto restart screen is now exited when the time has expired
- the auto restart screen is now exited when the time has expired
- start time is moved forward during moves, once per minute
- counter descaling could not exceed 3200 liters

Combi-Line NG software V1.01 (release date 01-05-2017)

- in ECO mode with no private logo the OK key did not blink
- Back does not work at start put process and error swivel / container
- Stop button works always when something went wrong with container or swivelarm

Combi-Line NG software V1.00 (release date 06-04-2017)

First release version